


Leaking from the Vertical ASA



POSSIBLE CAUSE: AZ O-ring (R015) is damaged

SOLUTION: Replace AZ O-Ring (R015)

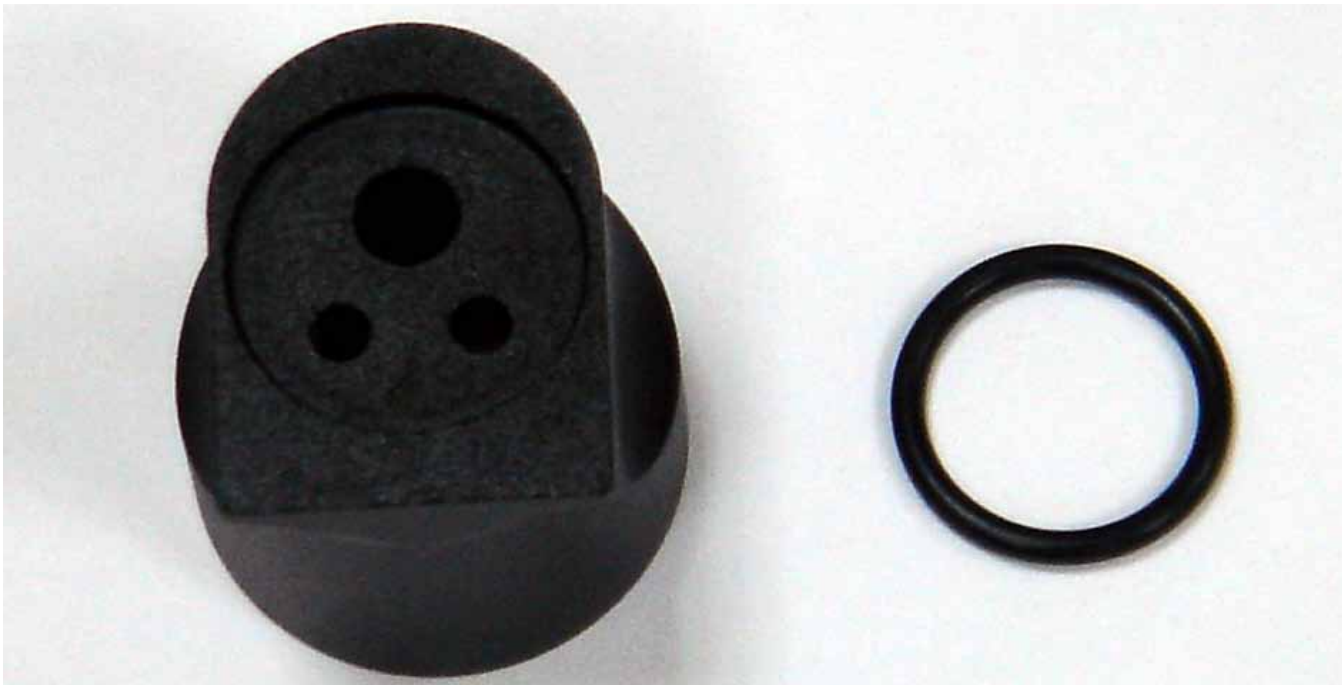

POSSIBLE CAUSE: AZ O-ring (R015) is damaged

SOLUTION: Replace AZ O-Ring (R015)